

Metal Cutting and Machine Tools
Prof. Asimava Roy Choudhury
Department of Mechanical Engineering
Indian Institute of Technology, Kharagpur

Lecture- 14
Calculations on mechanisms in machine tools

Welcome viewers to the 14th lecture of the online course Metal Cutting and Machine Tools. So, today after finishing the previous lecture on lathe, I could feel the requirement for some discussion on the typical mechanisms that we would be, that we would be coming across on the lathe on the milling machine etcetera. So, I have slightly changed the course of the lectures and included a small discussion on different types of mechanisms. So, some simple calculations are included. Let us move a right away into the calculations. So, 14th lecture calculations pertaining to machine tools.

(Refer Slide Time: 01:03)

Calculations pertaining to machine tools

Gear calculations

Gears have been represented in a simplified form. Z_i represents the number of teeth of i^{th} Gear. Gear 1 drives the train by rotating at 40 rpm. The rpm of the gear 5 in the gear train shown will be nearest to

1600
400
800
200

Fig. 2


Handwritten Calculations:
 $n_1 Z_1 = n_2 Z_2 \rightarrow 5$
 $n_2 = \frac{40 \times 210}{42} = 200$
 $n_3 = 200 \text{ rpm}$
 $n_4 = 400$
 $200 \times 84 = 42 \times n_4$

First of all calculations pertaining to gears, we have a gear train and we are given, what are we given? The gears have been represented in a simplified form that is understood they are represented as circles seen you know from an angle. So, in this particular view we are seeing gear numbers mentioned to you know identify them and numbers of teeth have been mentioned as Z_i . So, Z_1 represents the number of teeth of gear 1, Z_2 represents the number of teeth of gear 2 and their rotations per minute of the first gear

has been mentioned. So, this is the input. So, we understand that just a moment where is this, yeah this is the input rotation 40 rpm.

So, if 40 rpm is the input rotation the question is what is the rotations per minute of the fifth gear, fifth gear. The last one in the train. So, gear 1 is rotating gear 2 gear 2 is on the same shaft with gear 3, gear 3 is rotating gear 4 and gear 4 is on the same shaft as gear 5 if two gears are on the same shaft and they are integral in that case they will share the same rotations per minute their rpm will be the same or their angular velocities will be the same. What about two gears which are connected like this in mesh? They will have the same tangential velocity, with respect to this tangential velocity let us finish a quick calculation. First of all this is one gear and say this is another one, these are their pitch circumferences.

(Refer Slide Time: 03:15)

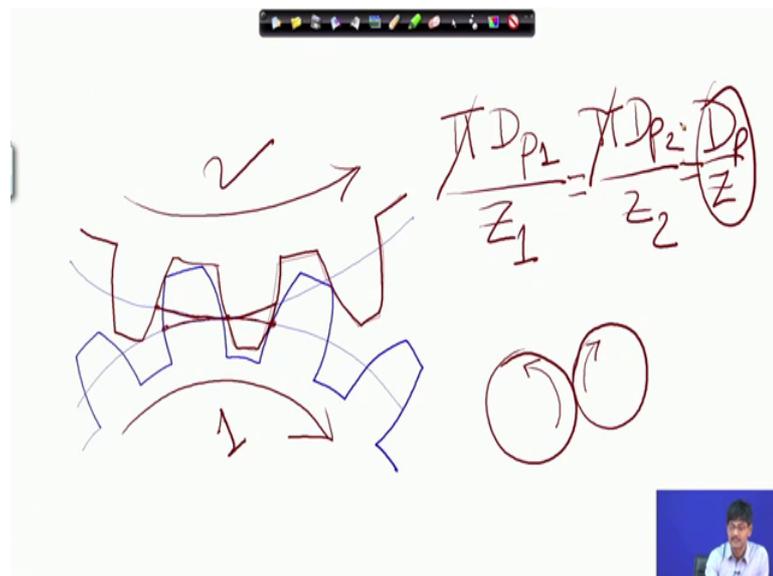

So, they are in contact with each other here and I draw the teeth of one gear this way and I draw the teeth of the other gear here, like this. Though the drawing is not very perfect, I have I think we can continue our expert discussion with these you know these geometry elements in view. These are the teeth of the gears, if this gear is rotating the other gear is made to rotate. And we understand that in order to have this meshing or this interconnection between two gears on the pitch circumference this distance from here to here. This one has to you know this, this one distance has to accommodate or rather this

So, if you go to the market and say that I want a gear of thirty two teeth the question that the shopkeeper will ask you is that what is your module. Module in system is slightly defined slightly differently, but to keep you know the discussions clear and easy to understand we will stick to basically module. There we have the existence of diametral pitch which is equal to Z by D_p where D_p is in inches, but we will do restrict our discussion to module. So, this point is understood gears which mesh with each other have a have a constant module or equal module and module differentiates families of gears which mesh with each other. So, now, that we have understood let us go back to our discussion of gears.

So, we express two gears this way and then we say that suppose this one gear and this is gear number 2, there in mesh with each other and this has say 40 teeth, Z_1 equal to 40 and Z_2 equal to 20 and in that case if N_1 is given to be 1000 rpm what is N_2 equal to. What is the value of N_2 ? So, in that case how do we solve it? We first of all say that as we observe last time this particular velocity is shared V_1 is equal to V_2 just a moment, if V_1 is equal to V_2 we can say V is nothing, but equal to $r \omega$. So, naturally we have $r_1 \omega_1$ equal to $r_2 \omega_2$ and you know for r convenience let us replace r by D , $D_1 \omega_1$ is equal to $D_2 \omega_2$ which means you know D_1 into and we replace ω by $2 \pi N$ by 60 equal to D_2 into N_2 $2 \pi N_2$ by 60 all these things will cancel out and we have D_1 is equal to and we have $D_1 N_1$ equal to $D_2 N_2$.

(Refer Slide Time: 10:40)

The image shows a whiteboard with handwritten mathematical equations in red ink. At the top, there is a toolbar with various drawing tools. The equations are as follows:

$$D_1 N_1 = D_2 N_2$$

$$\frac{D}{Z} = m$$

$$m Z_1 N_1 = m Z_2 N_2$$


$$N_1 Z_1 = N_2 Z_2$$

The last equation, $N_1 Z_1 = N_2 Z_2$, is circled in red. In the bottom right corner of the whiteboard, there is a small video inset showing a person speaking.

So, let us select a fresh page and write here $D_1 N_1 = D_2 N_2$ and therefore, since we have found previously d by Z you know D_p and D here they are the same things d by Z is equal to module I can replace here D with m into Z_1 into N_1 is equal to m into Z_2 into N_2 sorry this one is a mistake on my part module is the same for machine gears. Hence I cancel out module and I have $N_1 Z_1 = N_2 Z_2$ and therefore, if we go back to the problem. So, this is what we are going to use now and if we go back to the original discussion we find Z_1 is given N_1 is given. So, let us solve it right away we have $N_1 Z_1 = N_2 Z_2$ for these two machine gears therefore, I can say that N_2 can be found out as $N_1 Z_1 / Z_2$ 40 multiplied by 210 , divided by Z_2 . How much is Z_2 ? Z_2 is 42 , sure 42 goes into this 5 times, I hope 42 , 21 goes into this twice and on this 10 times and you can cancel it further 5 , yes 5 into 40 , so this is going to rotate at 200 rpm, N_2 is 200 rpm. So, this is also going to rotate m_3 is going to be the same as per our previous discussion 200 rpm.

Let us apply the same thing here $N_3 Z_3$; that means, 200 into Z_3 84 must be equal to Z_4 42 into N_4 that is good. So, we have this one cancelling out twice and therefore, we have N_4 is equal to 400 , N_4 is equal to 400 and you know they are sharing the rpm. So, this will also have rpm equal to 400 , n_5 is 400 the rpm of the gear 5 is 400 this one is correct. You might say what about Z_4 did not you have some role in the deciding of the rpm, no it is rotating in air not in connection with anyone, so it has absolutely no role here. So, just one thing I would like to mention here before we move on to the next subject.

(Refer Slide Time: 13:53)

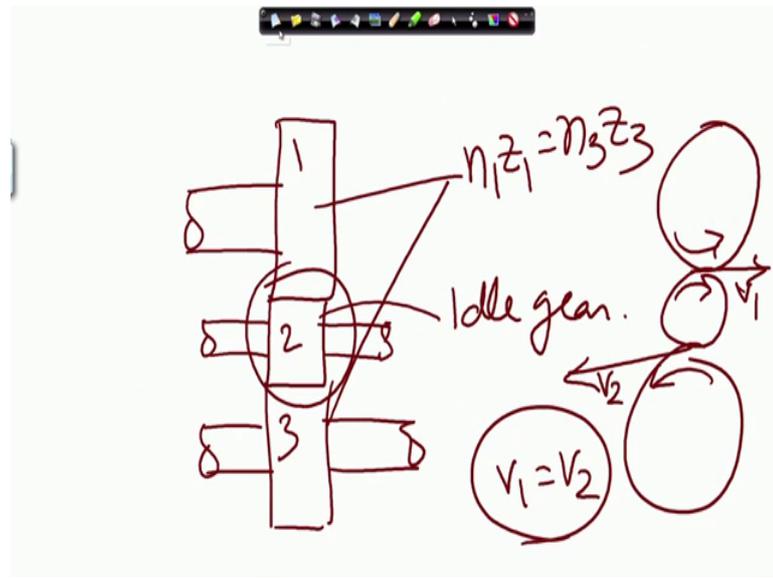

If you have a shaft in which you have a gear and you have another gear another shaft and you have yet another gear another shaft in that case what happens is if this is number 1, number 2, number 3, you can connect up $N_1 Z_1$ is equal to $N_3 Z_3$ directly instead of considering about 2, because 2 in this case is called an idle gear because you know in the in the other view it will look like this gear number 1, gear number 2, gear number 3 and they are rotating this way you know and therefore, they have the same tangential velocity this tangential velocity see let us call it V_1 and V_2 they are the same. V_1 and V_2 they are the same. What does that mean? That means, that I can directly establish the equality of velocities between these two elements that is it ok.

So, having established this one we will be utilizing all these results extensively in our discussions. So, this answer we have already established is 400. Let us move on to the next subject.

(Refer Slide Time: 15:23)

Calculations pertaining to machine tools

Gear calculations

A motor drives the train at 1440 rpm. Z_{wg} refers to number of teeth on the worm gear in connection with worm. The speed of the rack in m/min will be nearest to

60.652
28.893
14.476
5.324
None of the others

Fig. 3

Worm, $k = 2$

Motor 1440 rpm

$Z_{wg} = 40$

Gear A $Z = 32$

Gear B $Z = 30$

Rack, module = 2 mm

$N_A = 1440 \times \frac{2}{40}$

$1440 \times \frac{2}{40} \times \frac{32}{30} = N_B$

$Z_B = 30 \times N_B$

IIT KHARAGPUR | NPTEL ONLINE CERTIFICATION COURSES | ASIMAVA RI MECHANIC/ IIT KH

Oh my god, what an elaborate example. So, I will come back to this one. I will come back to this because at this moment we are not having any knowledge of you know what should be the speed ratio between worm and worm gear. Let us discuss all those aspects.

(Refer Slide Time: 15:43)

Calculations pertaining to machine tools

Screw thread calculations

Number of starts

Pitch and lead


IIT KHARAGPUR | NPTEL ONLINE CERTIFICATION COURSES | ASIMAVA RI MECHANIC/ IIT KH

This is a threaded element. What is the meaning of a threaded element? It means that on the circumference of a let me draw it on the circumference of a cylinder, outer wall of a cylinder suppose I am climbing up you all seen spiral stairway maybe all of you have visited places like the Qutub Minar I do not know during your time whether the whether

you are allowed to move up the Qutub Minar, but in our time we were allowed up to ascertain I think the first storey. And it was a helical climb, there was a helix that means, a helix goes all around the cylinder and it rises while its rotating all around it rises violet rotates that is a helix.

So, whenever we are having such you know such helices in machine tool elements I mean machine elements they serve some purpose they can be used as clamping devices, they can be used as divines devices for deriving motion etcetera and therefore, we come across today's discussion about screw threads, screw threads. Let us see how they help us. First of all what is this screw thread doing? What information does it give us? For example, in a screw thread you will find that there are some typical definitions attached to it. What sort of definitions are these?

(Refer Slide Time: 17:20)

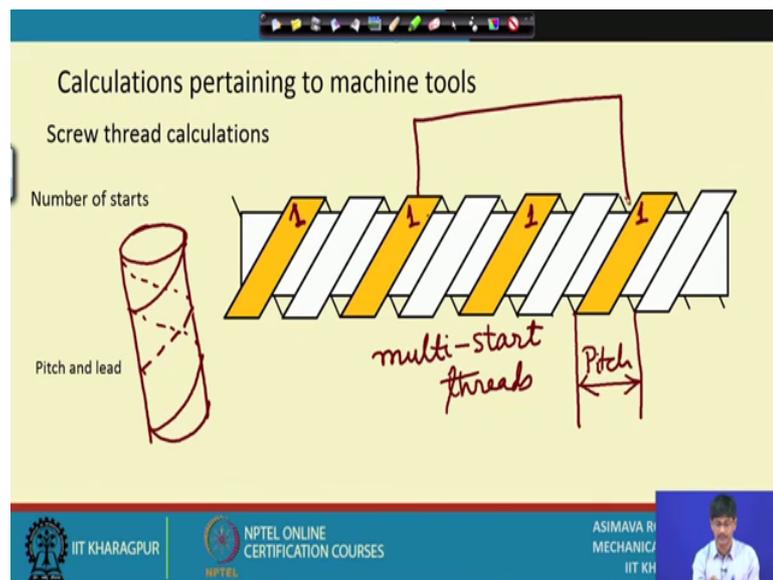

For example, distance between similar successive points on a thread. So, first of all this is a helix similar successive points on a thread it is called pitch, this one is called pitch. So, what is so great about that? You find surprisingly that there is not a single helix in this one, but there are two parallel helices this is helix 1, they given a different color helix 2, helix 3, helix 4, like that what does it mean? It means that, this is it means that this is helix sorry I should not have written helix 1, helix 2 this will unnecessarily confuse you. This is helix 1 only continued. What does it mean? It means that this helix is absolutely independent from that one, they are climbing parallel. But how does it show

up on the cylinder? If this is the cylinder it shows up this way, this is one helix climbing up etcetera helix one. So, it moves all around this way and there is yet another helix. So, let me give it a different color it is this one sorry, it is the same color, just a movement oh I could not change the color. So, I can change at least the font. There is yet another helix moving this way.

So, parallel helices just like your spiral stairways to parallel spiral stairways. What purpose does it serve? In this case it is always referred to you know if you have 3 helices or 4 helices or 5 helices it is called multi start threads, multi start threads. What purpose do they serve? In that case if you have up you know nut connected to it just a moment yeah if you have a nut connected on that, nut is a device which has you know fitting grooves on it into which these threaded elements can be fit in. So, this is the nut; if you rotate the screw and if you hold the nut steady so that it cannot rotate it will execute translational motion.

(Refer Slide Time: 20:04)

Calculations pertaining to machine tools

Screw thread calculations

Number of starts $N_{screw} = 1000$

Pitch and lead

If $k = \text{no. of starts} = 1$


Nut $V = \text{pitch} \times \text{rpm of screw} = 4 \times 1000 = 4\text{m/min}$

Nut pitch = 4 mm

Now, if for single start threads, if let me write if N is equal to sorry if k equal to number of such helices a separate helices it is called number of starts equal to 1 in that case the movement of this nut pass this screw I mean if it is not allowed to rotate with the screw and if the screw is not allowed to translate in that case the movement is pitch into rpm. So, we can write nut velocity. Velocity of the nut will be equal to pitch multiplied by the rpm.

Let us have an example suppose the rotation of the screw, rpm of screw is equal to 1000 rpm. So, in that case if pitch be equal to nut pitch and screw pitch has to be the same otherwise they will not match nut pitch is say 4 millimetres, in that case this will be equal to 4 multiplied by 1000 equal to 4 meters per minute just imagine 4 meters per minute will be the movement of the screw if number of starts equal to 1. However, if there are two starts as shown in this figure there is another term defined. So, there is another term defined which is called lead while this was your pitch.


(Refer Slide Time: 22:23)

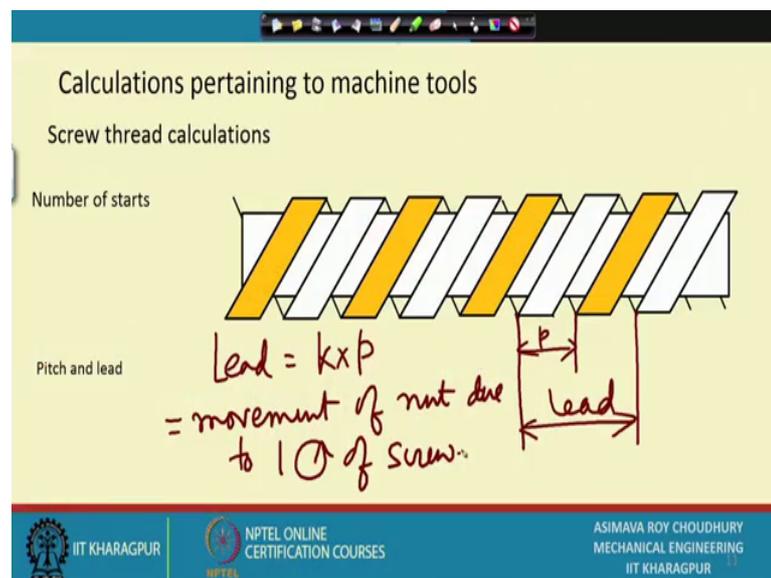

So, we have lead equal to k into pitch, k is the number of starts and equal to movement of nut due to one rotation of screw. So, ultimately it boils down to the fact that if the nut is sorry if the if the nut and screw they are of multi starts say there of double starts in that case if you rotate the screw once the nut does not rotate by the pitch, but it rotates I mean does not move by the pitch, but it moves by the lead where lead is equal to number of starts into the pitch. Having established that we understand that this is the way in which the nut and screw work.

Now, let us move on to the last machine element pair that we have to discuss.

(Refer Slide Time: 23:44)

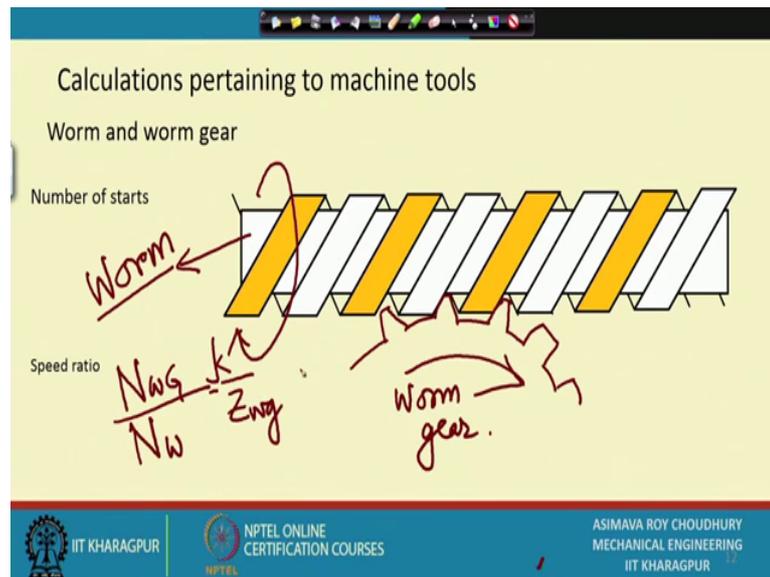

The worm and worm gear. What is the worm and worm gear? For that, let us now at this moment let us identify the worm by simply referring to it as a threaded I am sorry, just a moment; by simply referring to it as a threaded element. So, this is our worm. So, why are we suddenly bringing in this term? Because it is when it is coupled by another machine element it worms the very popular device for speed reduction called a worm and worm gear.

So, what is the worm gear in connection with the worm? You know the moment people started thinking about different machine events at one point in time they connected up to different machine elements, the screw and the gear, the screw and the gear. So, that they made this sort of a connection, like that, which means that if the screw is rotating if the screw is rotating the worm gear will have to rotate with it in which way that is tooth by tooth this particular helix as it is slightly you know inclined these points will be coming sequentially and they will be pushing the wheel toothed wheel to one side and this is called the worm gear.

So, what is so great about it? The thing which is great about this machine element pair is that it can bring in huge reduction in speed only in one stage generally if you are trying to reduce the speed maybe with the help of sliding clusters you can reduce the speed by say a factor of 1, a factor of 2, maximum maybe 3, but not more than that at one stage, but at one stage itself the worm and worm gear can reduce the speed by a factor of 40

just imagine, factor of 40. What is the speed ratio? So, the speed ratio of the worm and worm gear is equal to N worm gear. Why is it called the worm? Because it looks like an earthworm that is why N worm gear divided by the rpm of the worm is equal to k by Z w g. Let me draw it a bit more clearly.

(Refer Slide Time: 26:42)

Calculations pertaining to machine tools

Worm and worm gear

Number of starts

Speed ratio

$$\frac{1}{40} = \frac{2}{80} = \frac{N_{wg}}{N_w} = \frac{k}{Z_{wg}}$$

Z_{wg} = Number of teeth on worm gear
 k = no of starts of worm.

IIT KHARAGPUR | NPTEL ONLINE CERTIFICATION COURSES | ASIMAVA RI MECHANIC/ IIT KH

N worm gear divided by N worm is equal to k by Z w g, where Z w g is equal to number of teeth on worm gear. What is the worm gear? The one which is connected to the screw and key is already defined number of starts of worm. So, having understood this we see that the ratio of these two speeds can really be very very you know small in what way suppose k is equal to 2 and suppose Z w g is equal to 80. So, this will be equal to 2 by 80 equal to 1 by 40. So, this is the capability of this device and we will have extensive use of it in our mechanisms.

So, with this one let us quickly go to the previous slide in which we had some discussion on this sorry, just a moment. Yeah, this is the one, this is the one. Let us quickly solve this and end our class today. The motor rotates at 1440 rpm, Z w g refers to the number of teeth on the worm gear in connection with the worm that is understood, the speed of the rack in meters per minute will be nearest to.

So, what do we have here? The motor, connected to the worm number of starts is equal to 2, this is the worm gear its teeth have not been shown, number of teeth on the worm gear is 40 and on the same shaft we have another gear where the number of teeth is equal

to 32 that is in connection with a gear B whose number of teeth is equal to 30 that is in connection with a straight sided gear called a rack with module 2 we have to find out the speed of the rack in meters per minute. So, let us move right away. 1440 rpm sorry; 1440 rpm is the rpm of the motor we start from the motor. Next we come to the worm gear worm gear converts this rpm I mean the worm and worm gear pair, changes this rpm as per its speed ratio. So, speed ratio is already known K by Z , K by Z which means this is nothing, but 1440 multiplied by 2 divided by 40.

So, this part so far so good. So, this is now can be removable, we have moved up to the worm gear shaft, that shaft is containing this gear. So, it must be having the same rpm. So, this must be equal to the rpm of gear A. So, this is also equal to N_A , that is good therefore, we move 1440 into 2 by 40 multiplied by you know N_A , Z_A will be equal to $N_B Z_B$ equal to what is this and just a moment let it be, into $N_A Z_A$ 32 must be equal to $N_B Z_B$ equal to 30 multiplied by N_B . Now, how much is that? We have, let us have a quick cut 0 0 cancels, this one cancels with this, 4 8 za 32, 16, 16 this 2 let it go with this one 15. So, we have, we have how much? 8 here; 1440, 144 into 8 divided by 15.

(Refer Slide Time: 31:52)

Calculations pertaining to machine tools

Gear calculations

A motor drives the train at 1440 rpm. Z_{wg} refers to number of teeth on the worm gear in connection with worm. The speed of the rack in m/min will be nearest to

60.652
28.893
14.478 ✓
5.324
None of the others

Fig. 3

Worm, $k = 2$
Gear A, $Z = 32$
Gear B, $Z = 30$
Rack, module = 2 mm

Handwritten calculations:

$$N_B = \frac{144 \times 8}{15}$$

$$V = \frac{144 \times 8}{15} \times \pi \times m \times Z = \frac{144 \times 8}{15} \times \pi \times 2 \times 30 = 32 \times 144 \times \pi$$

IIT KHARAGPUR | NPTEL ONLINE CERTIFICATION COURSES | ASIMAVA ROY CHOUDHURY MECHANICAL ENGINEERING IIT KHARAGPUR

N_B equal to 144 into 8 divided by 15. What do we have here? After this the rack is being moved due to its connection with Z_B . What is the speed of the rack?

Now, they must be sharing the same velocity here. What is this velocity? It must be number of rotations multiplied by the circumference in one rotation it moves by the

circumference. So, in N number of rotations it must be moved moving by N into the circumference. So, N is this. So, we have the velocity to be velocity is equal to 144 into 8 divided by 15 into as we discussed into the circumference, circumference pi into d. What is d? d is equal to module into Z. So, module is 2 m into Z equal to 144 into 8 divided by 15 into pi into 2, module is 2 into 30 that is it this should be the answer 2, 4, so 4 8 za 32, once again 32 into 144 into pi.

So, this has been named as the correct answer in meters per minute all these things were in millimetres. So, we will have in to divided by 10 to the power 3. I leave it to you to check whether this one is correct. Let me write it down 32 144 pi, please check yourselves, 144 into 32 pi divided by 1000, is this equal to this one you have to check.

(Refer Slide Time: 33:48)

Calculations pertaining to machine tools

Gear calculations

A motor drives the train at 1440 rpm. Z_{wg} refers to number of teeth on the worm gear in connection with worm. The speed of the rack in m/min will be nearest to

60.652
28.893
14.476
5.324
None of the others

Fig. 3

Motor 1440 rpm

Worm, $k = 2$

Gear A $Z = 32$

Gear B $Z = 30$

Rack, module = 2 mm

$Z_{wg} = 40$

$2 \cdot \frac{144 \times 32 \pi}{1000}$

So, with this we come to the end of today's discussion.

Thank you very much.